
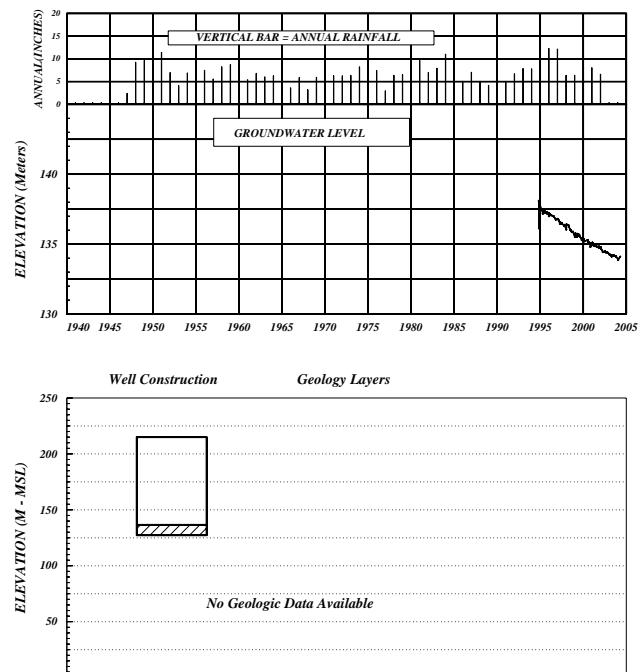
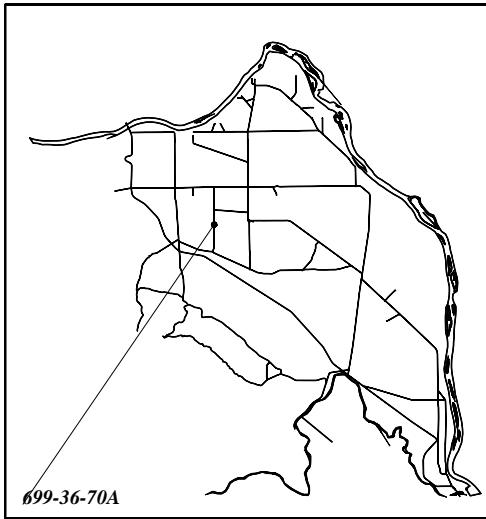


# DOE HANFORD SITE - GROUNDWATER QUALITY DATA PLOTS

wellseries-600-699 WELL#=699-36-70A

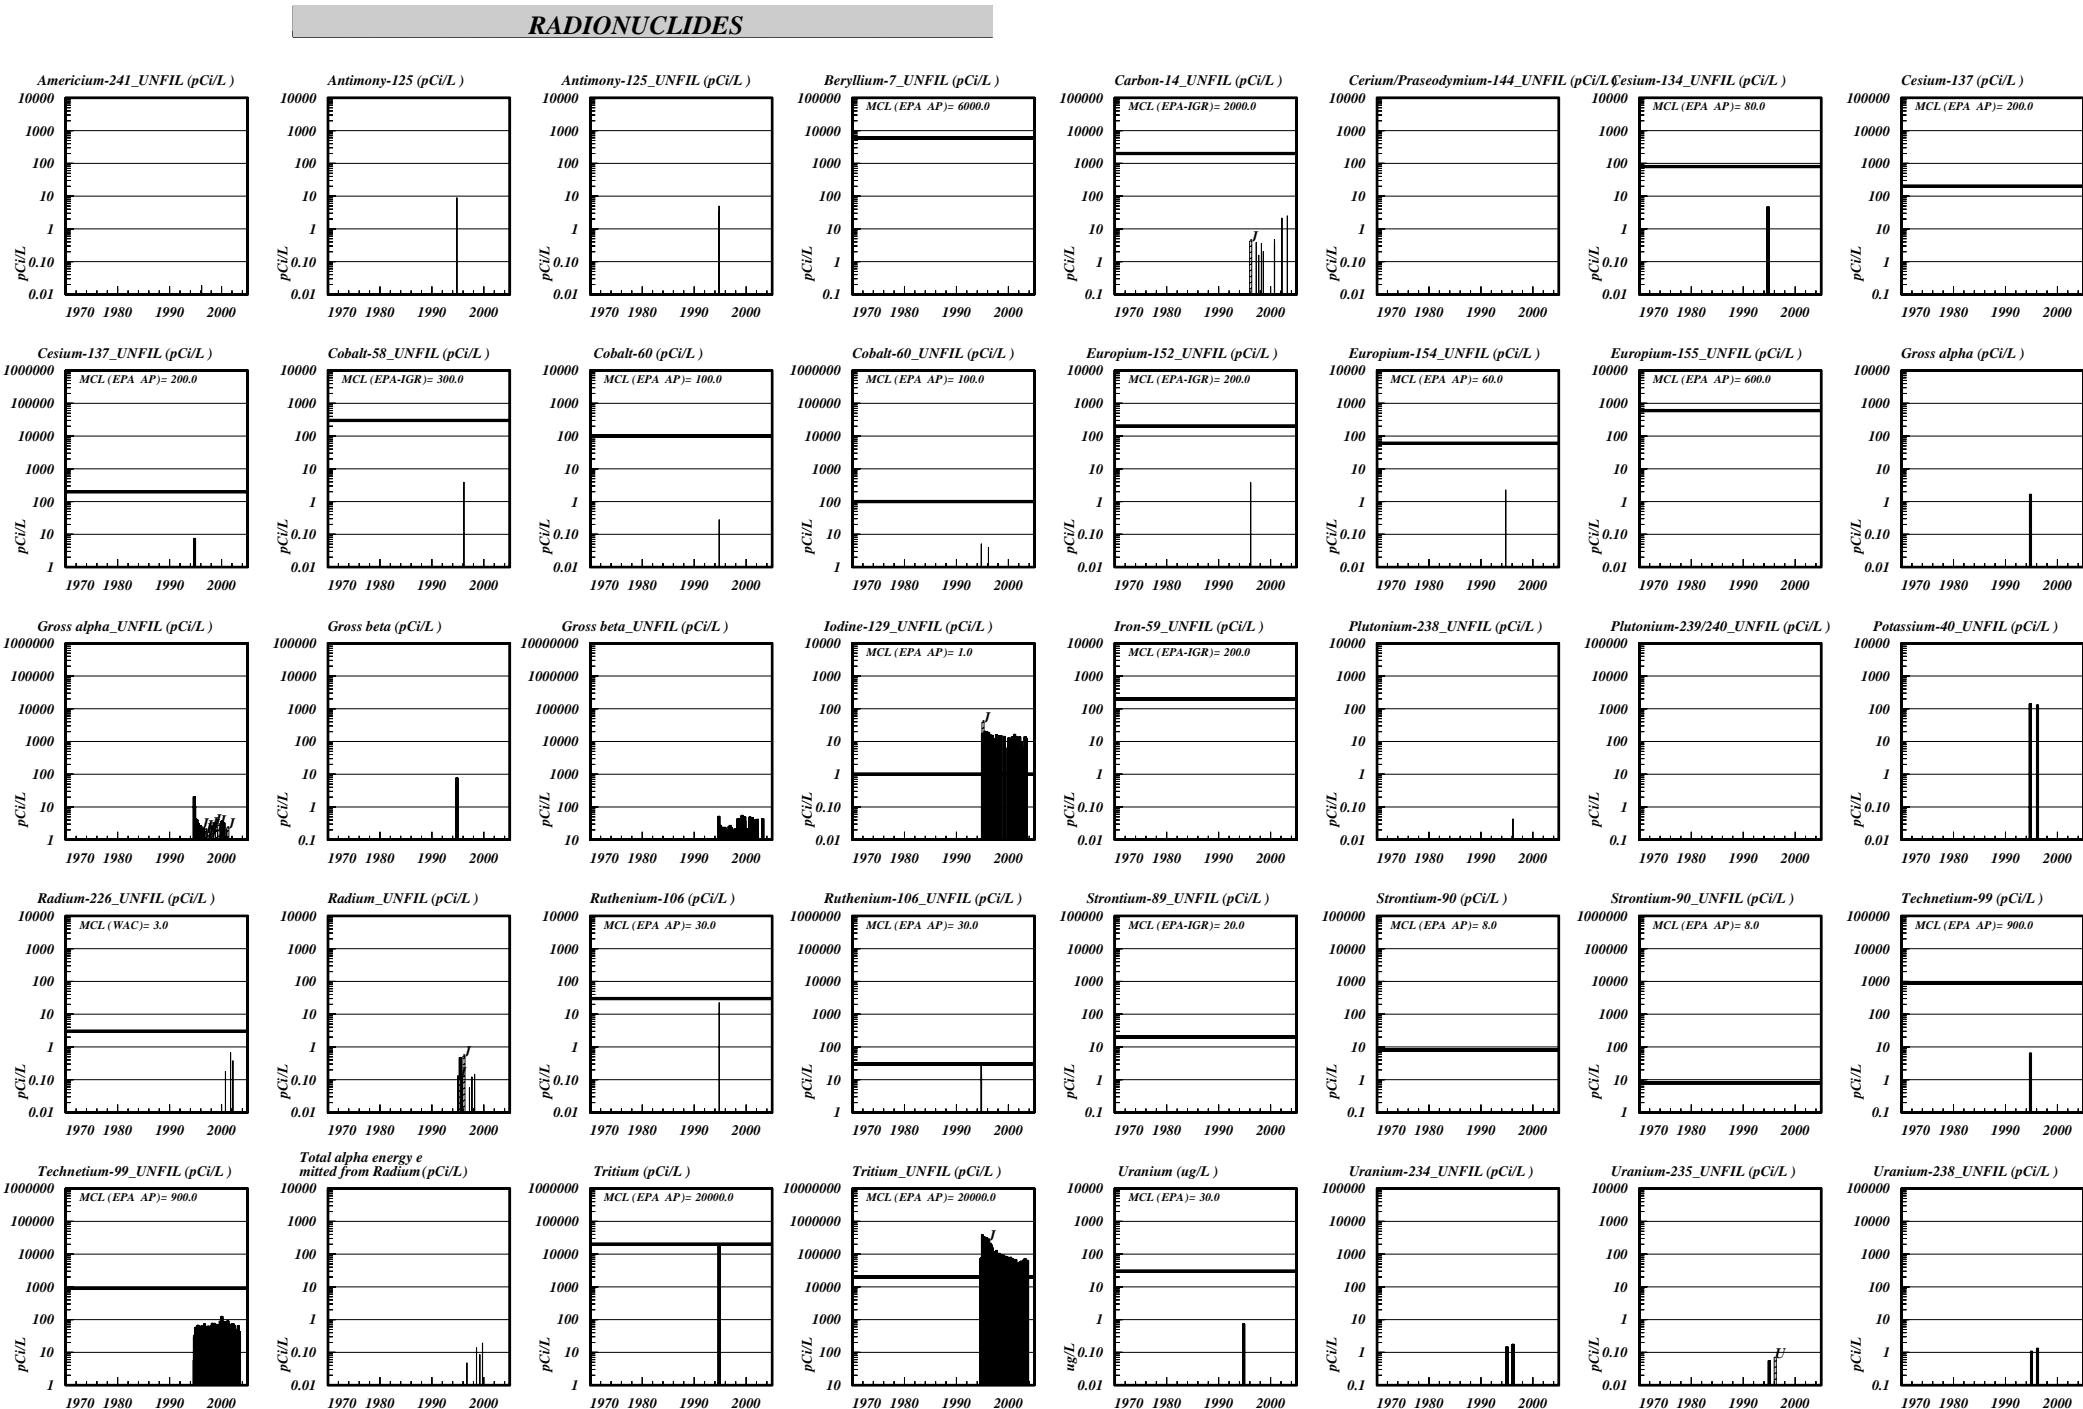

**WELLNAME=699-36-70A WELLID=A9901**

Well Type=STANDARD Well purpose=GROUNDWATER  
 Owner=DOE Contact=BHI Well Adm Compliance=COMPLIANT  
 X\_coor= 563466.70 Y\_coor= 134308.90 Datum=NAD83(91) Date Survey=12/14/1994  
 Elevation= 215.007 Datum=NAVD88 Date Survey=12/14/94  
 Ref Point Desc=BRASS CAP Ref Point side=NONE Contractor=KEH  
 Total Number of Screen Intervals=1  
 Screen#1 Screen\_diam= 4.00 in Top= 78.46 Bottom= 87.60 m Slot\_size= 0.01 in  
 Screen\_material=Stainless Steel


LABORATORY QUALIFIER FLAGS in HEIS are \*, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value; L=Value between IDL and CRQL (estimated); T=Tentatively identified compound:  
 EPA-IGR=EPA-Implementation Guidance for Radionuclides. WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit; THIN BARS=Value Below Detection Limit; HATCHED BARS=Value With Data Qualifier Flag


# DOE HANFORD SITE - GROUNDWATER QUALITY DATA PLOTS

wellseries-600-699 WELL#=699-36-70A

## RADIONUCLIDES


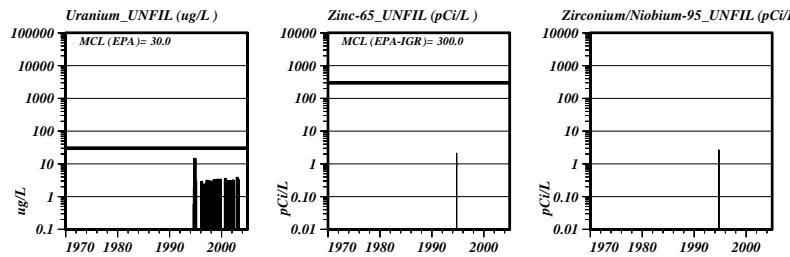


## VOLATILE ORGANIC COMPOUNDS

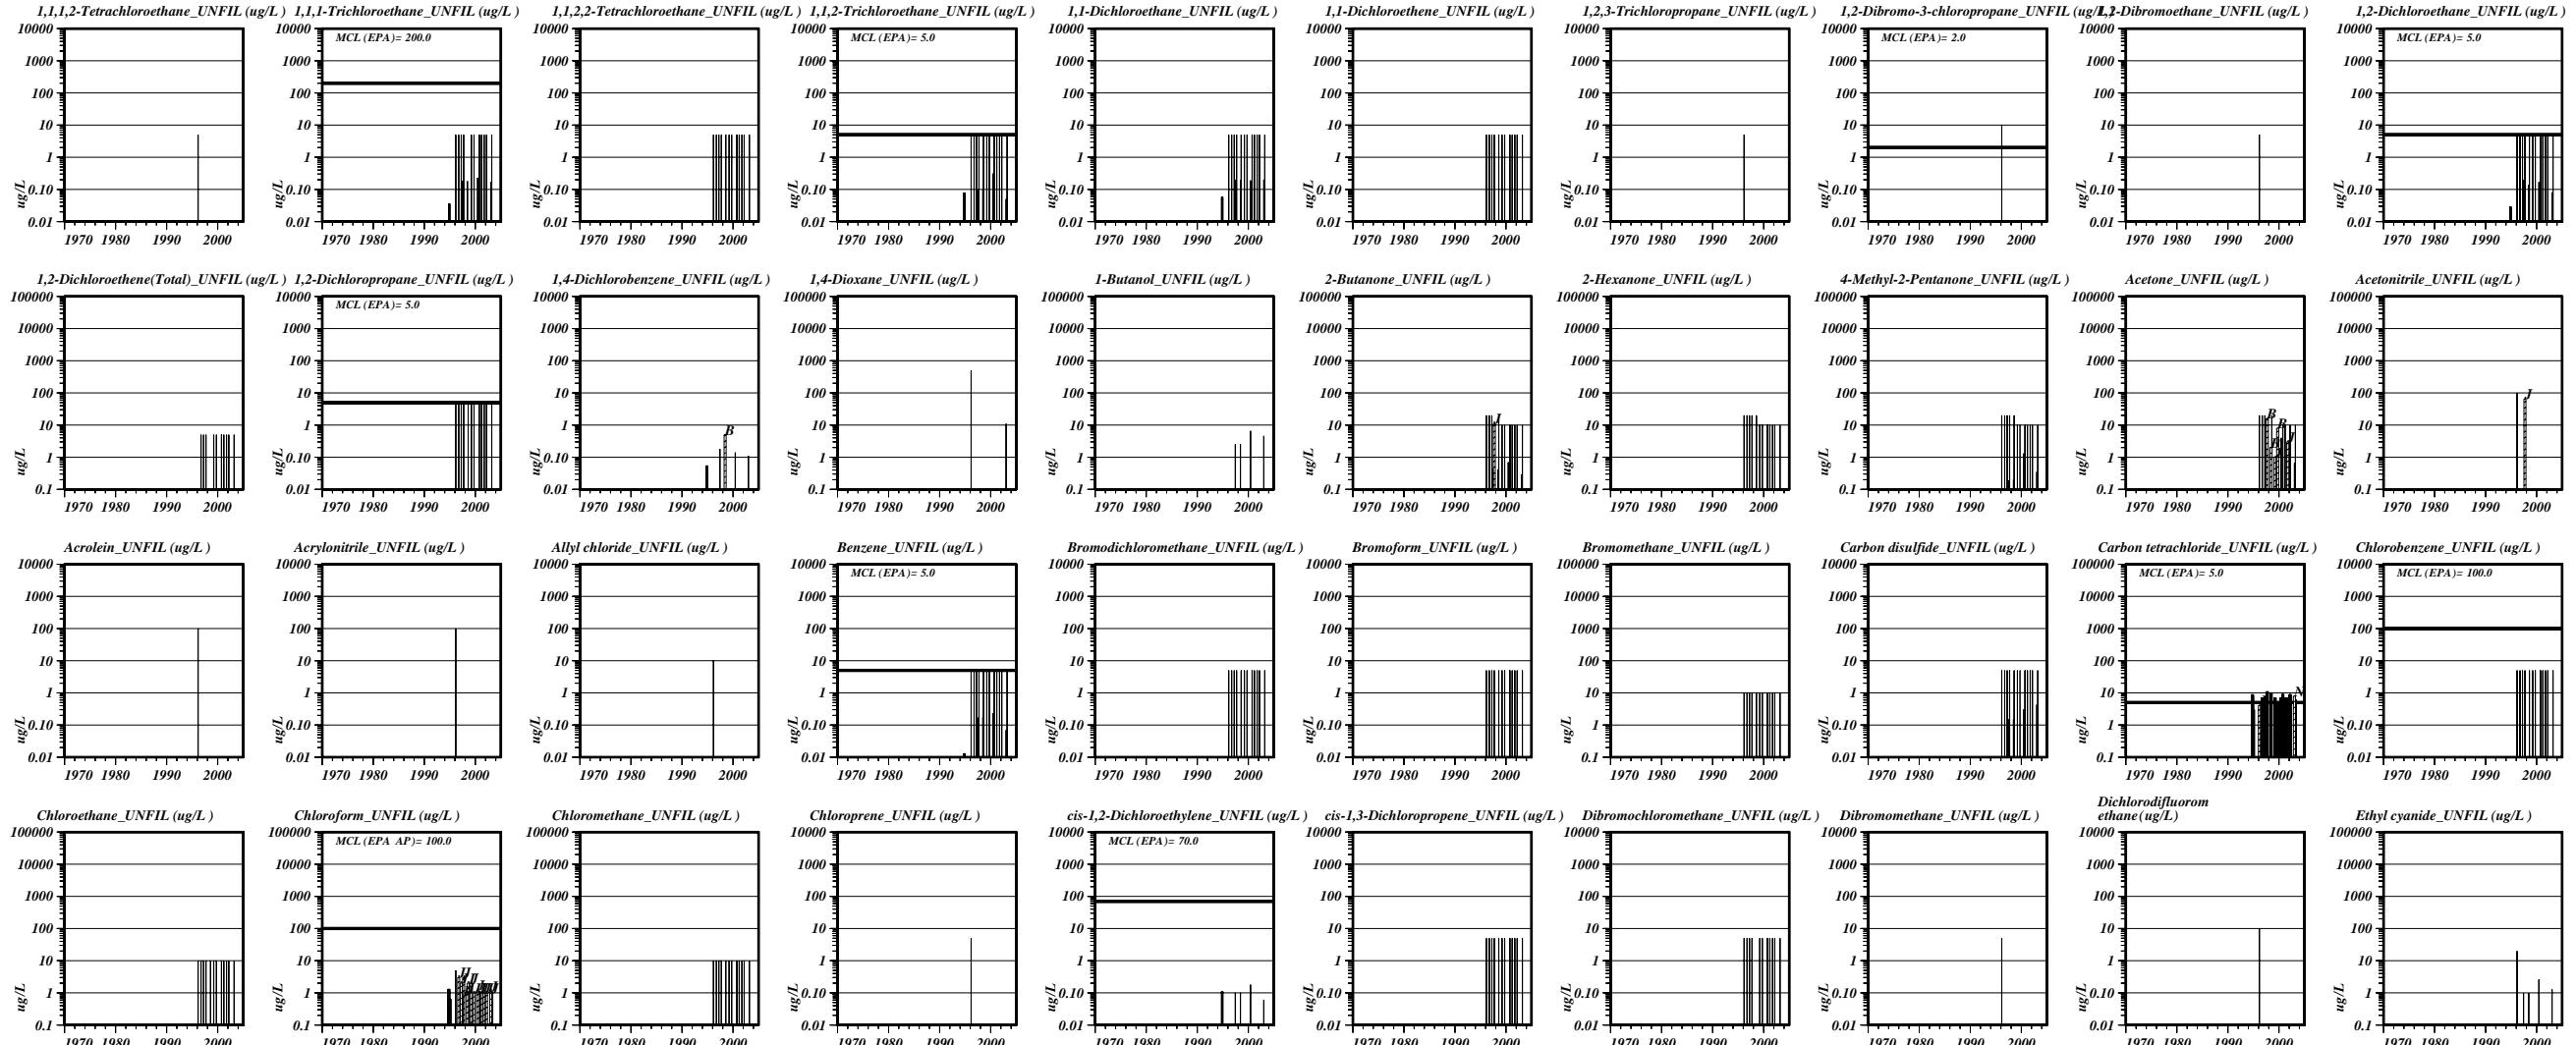

LABORATORY QUALIFIER FLAGS in HEIS are \*; >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value; L=Value between IDL and CRQL (estimated); T=Tentatively identified compound;  
EPA-IGR=EPA-Implementation Guidance for Radionuclides; WAC=Washington Administrative Code:


EXPLANATION: THICK FILLED BARS=Value Above Detection Limit; THIN BARS=Value Below Detection Limit; HATCHED BARS=Value With Data Qualifier Flag

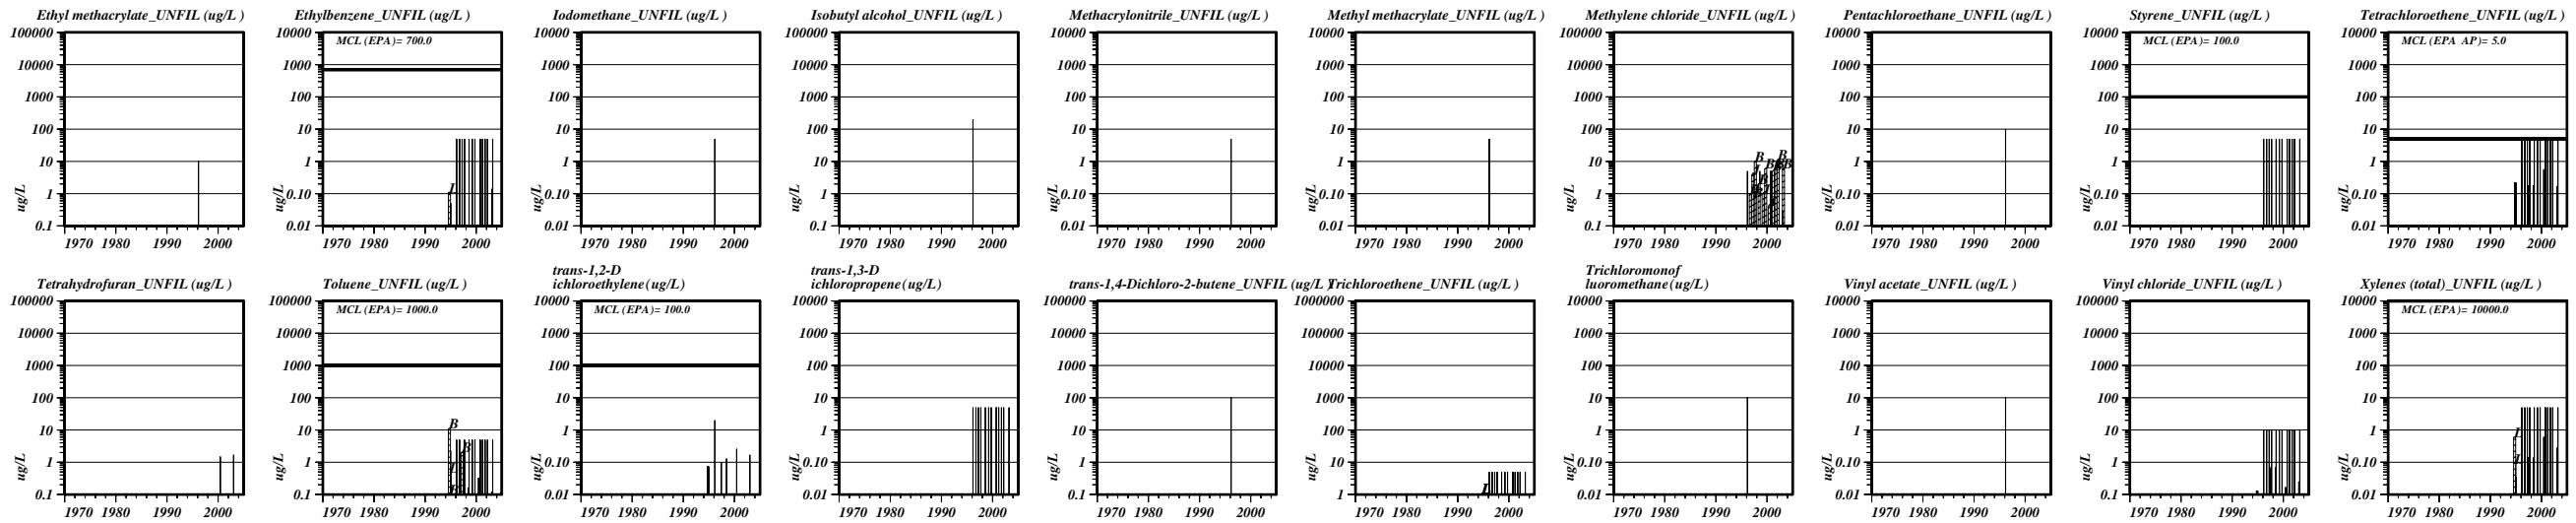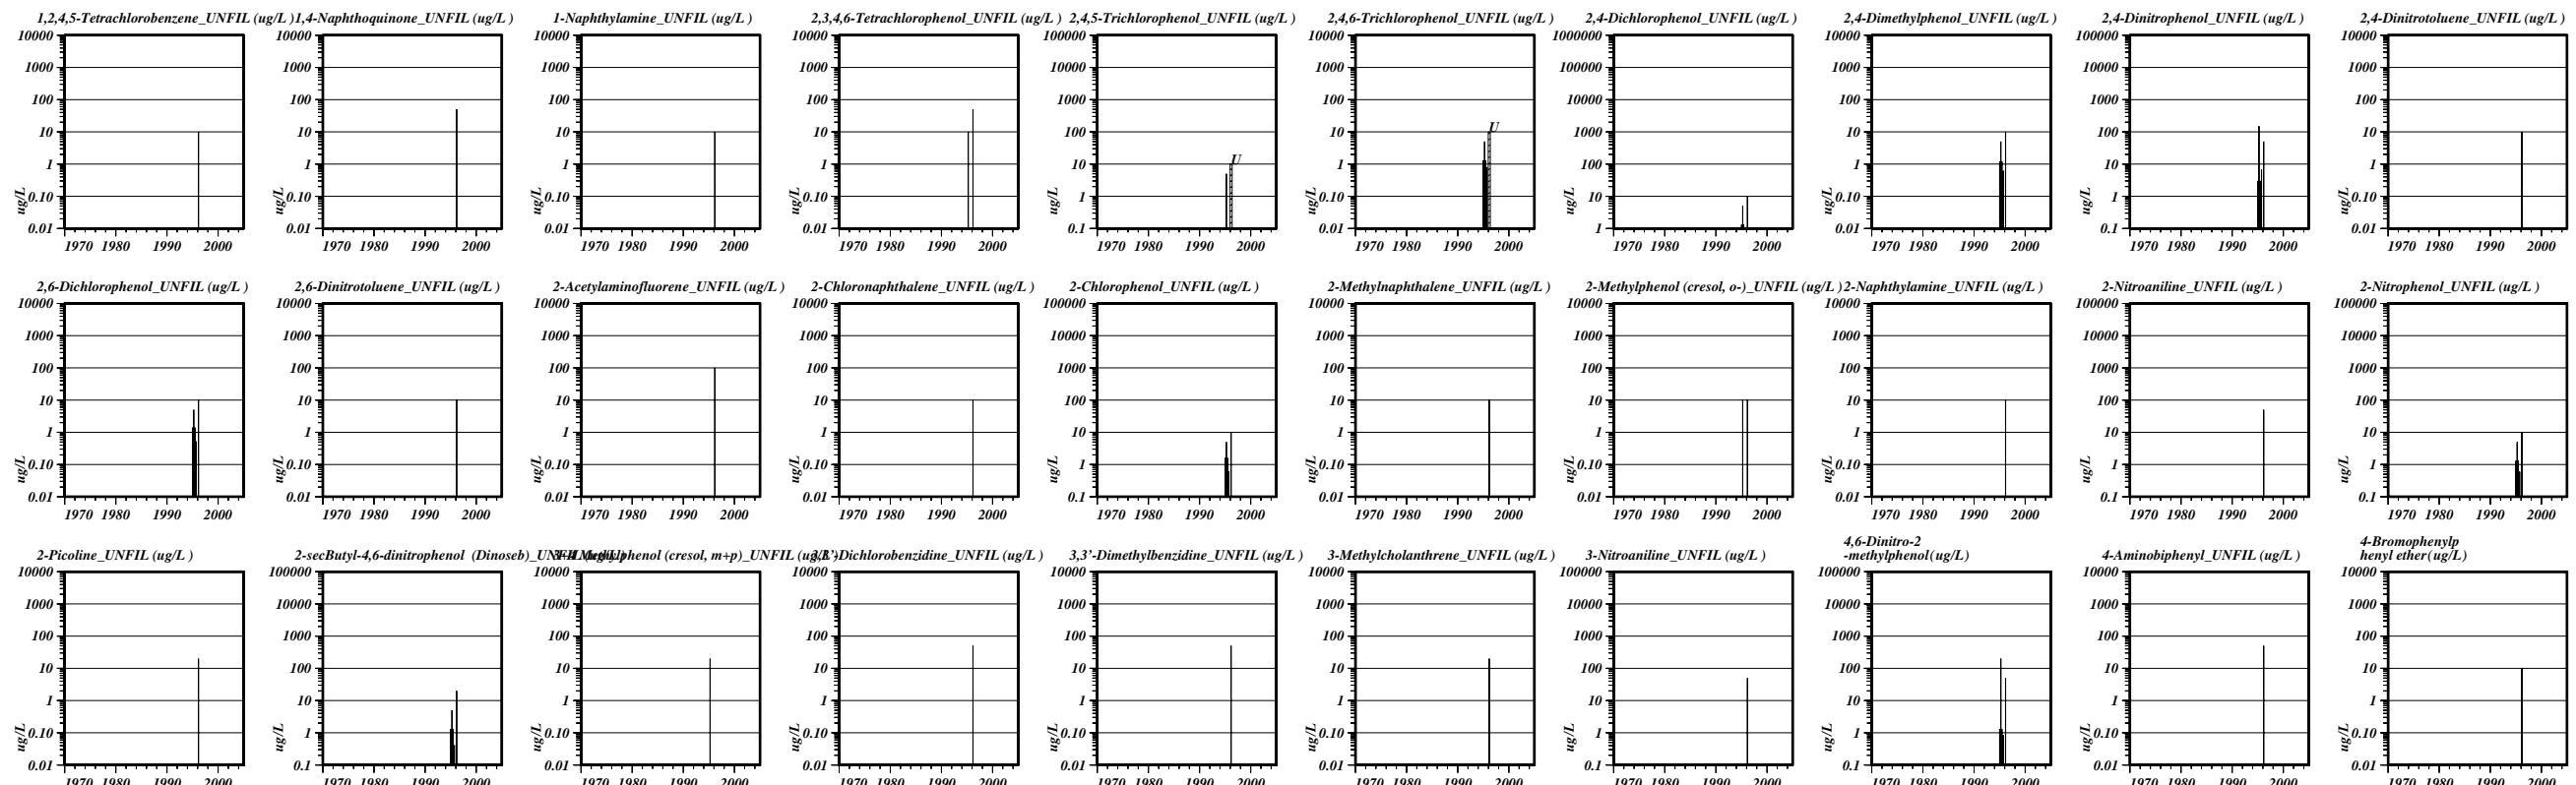**VOLATILE ORGANIC COMPOUNDS****SEMI-VOLATILE ORGANIC COMPOUNDS**

LABORATORY QUALIFIER FLAGS in HEIS are \*; >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value; L=Value between IDL and CRQL (estimated); T=Tentatively identified compound;  
EPA-IGR=EPA-Implementation Guidance for Radionuclides; WAC=Washington Administrative Code;



EXPLANATION: THICK FILLED BARS=Value Above Detection Limit; THIN BARS=Value Below Detection Limit; HATCHED BARS=Value With Data Qualifier Flag

## SEMI-VOLATILE ORGANIC COMPOUNDS

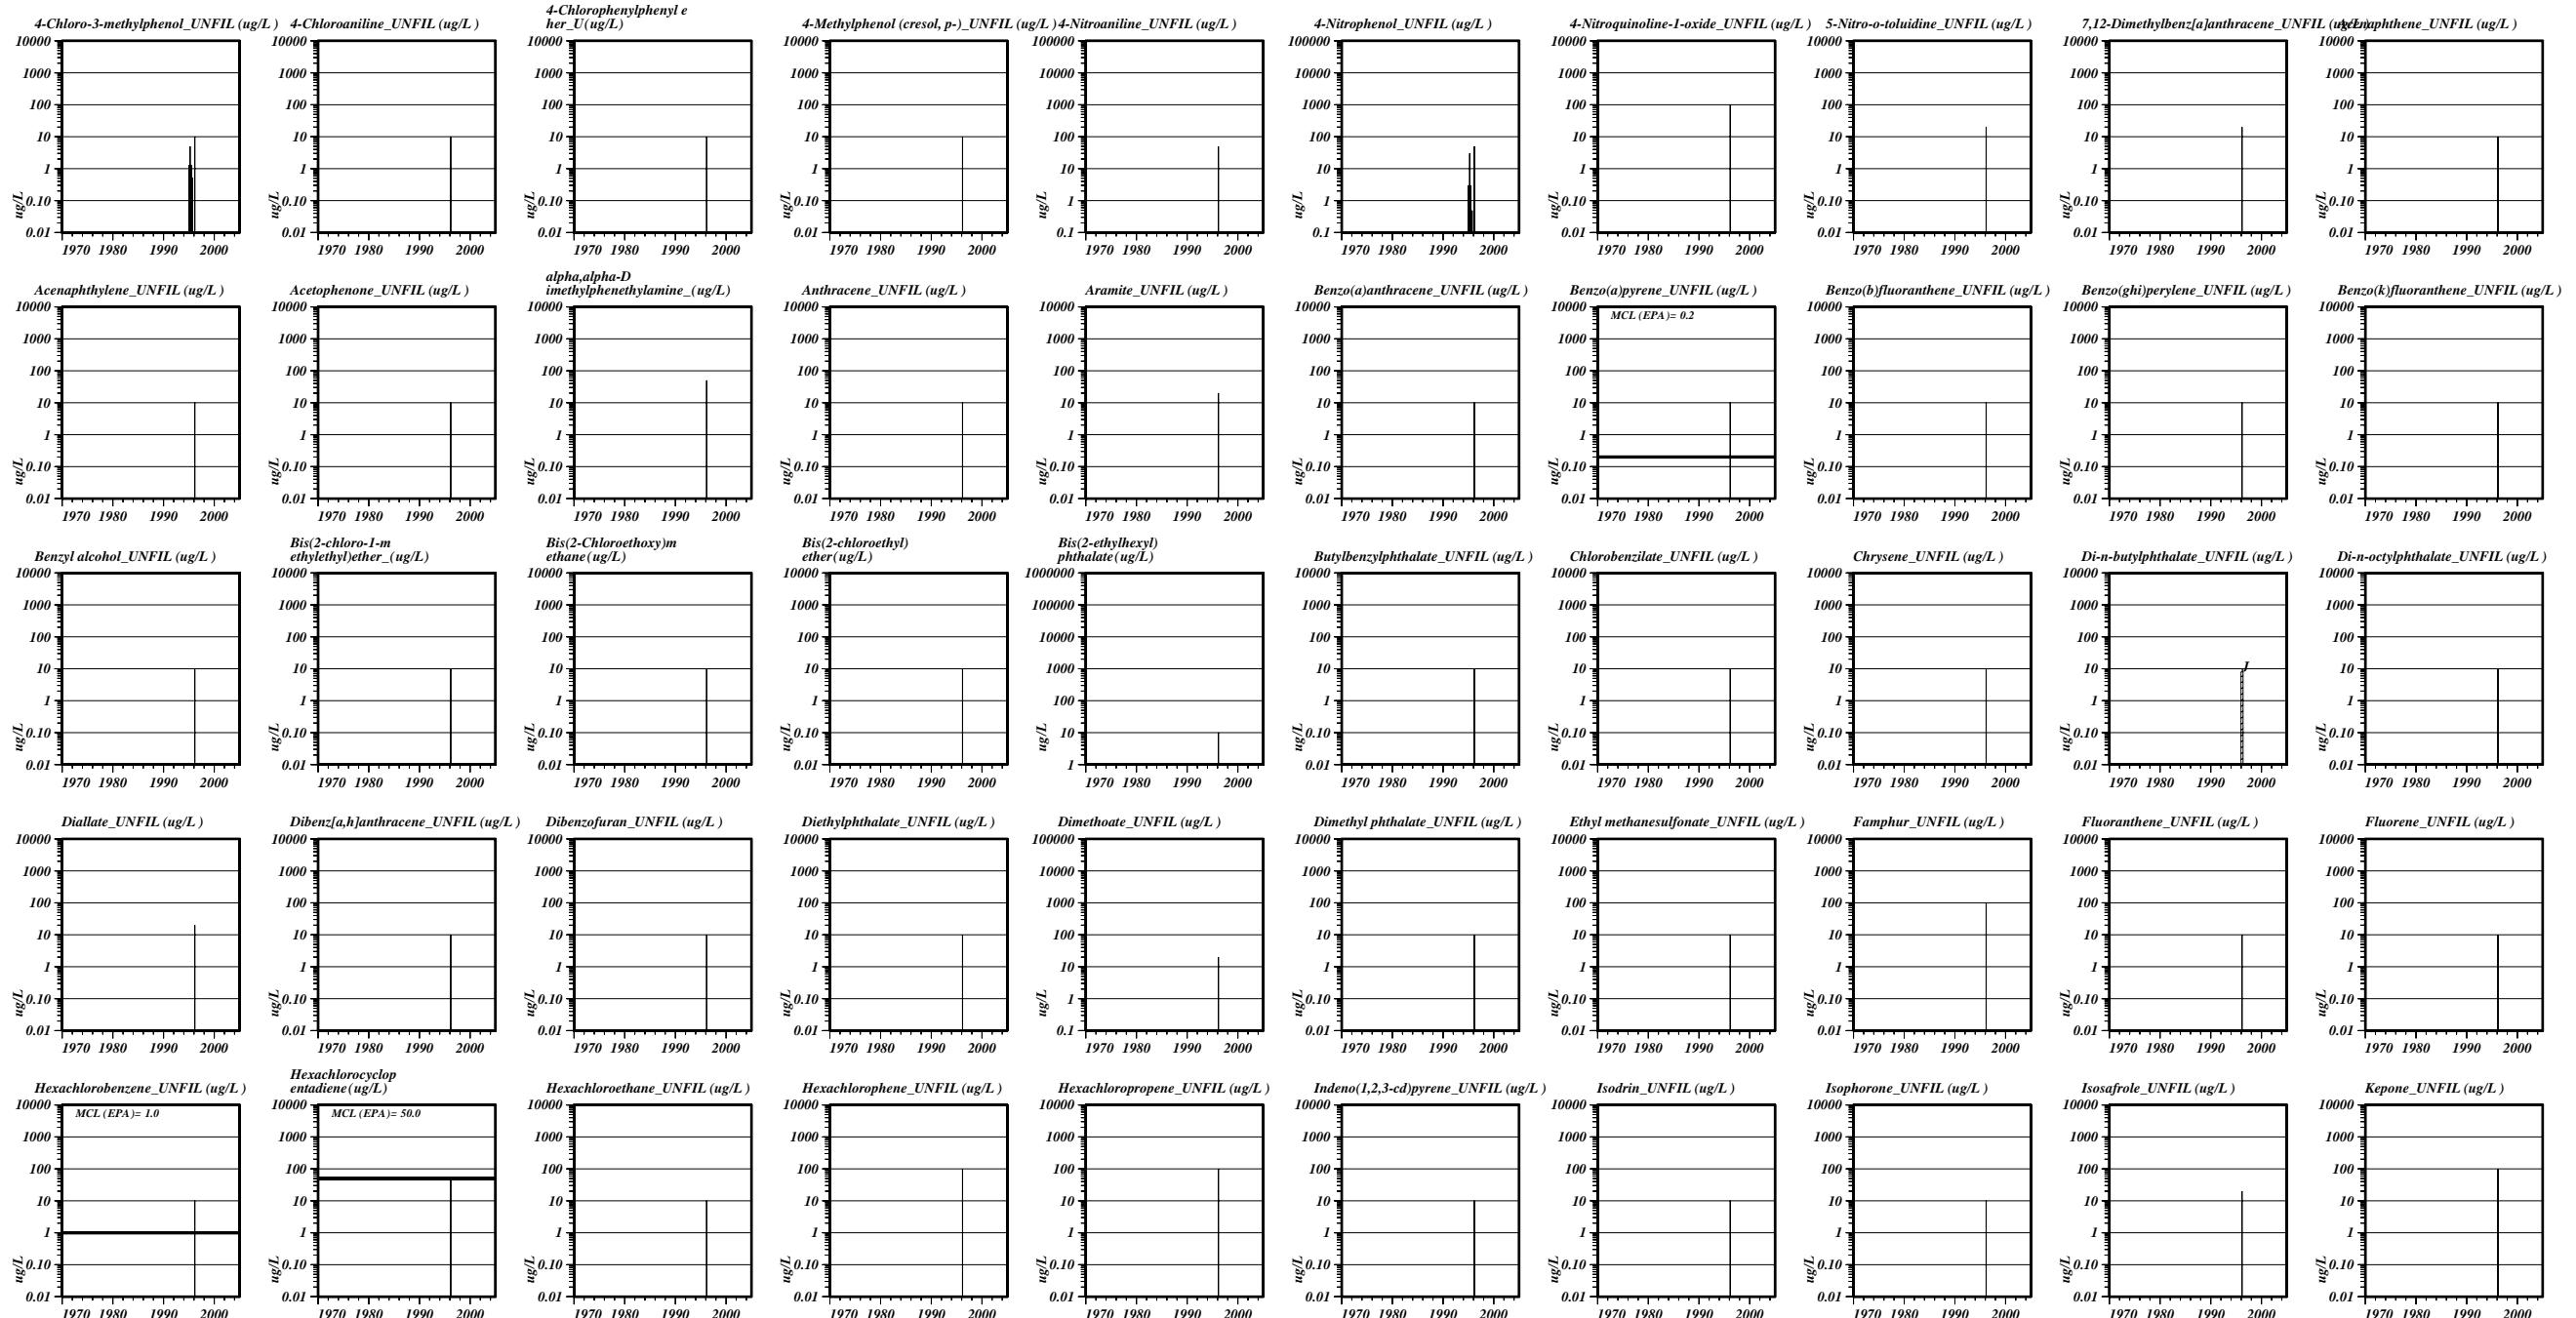

LABORATORY QUALIFIER FLAGS in HEIS are \*, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value; L=Value between IDL and CRQL (estimated); T=Tentatively identified compound:  
EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit; THIN BARS=Value Below Detection Limit; HATCHED BARS=Value With Data Qualifier Flag

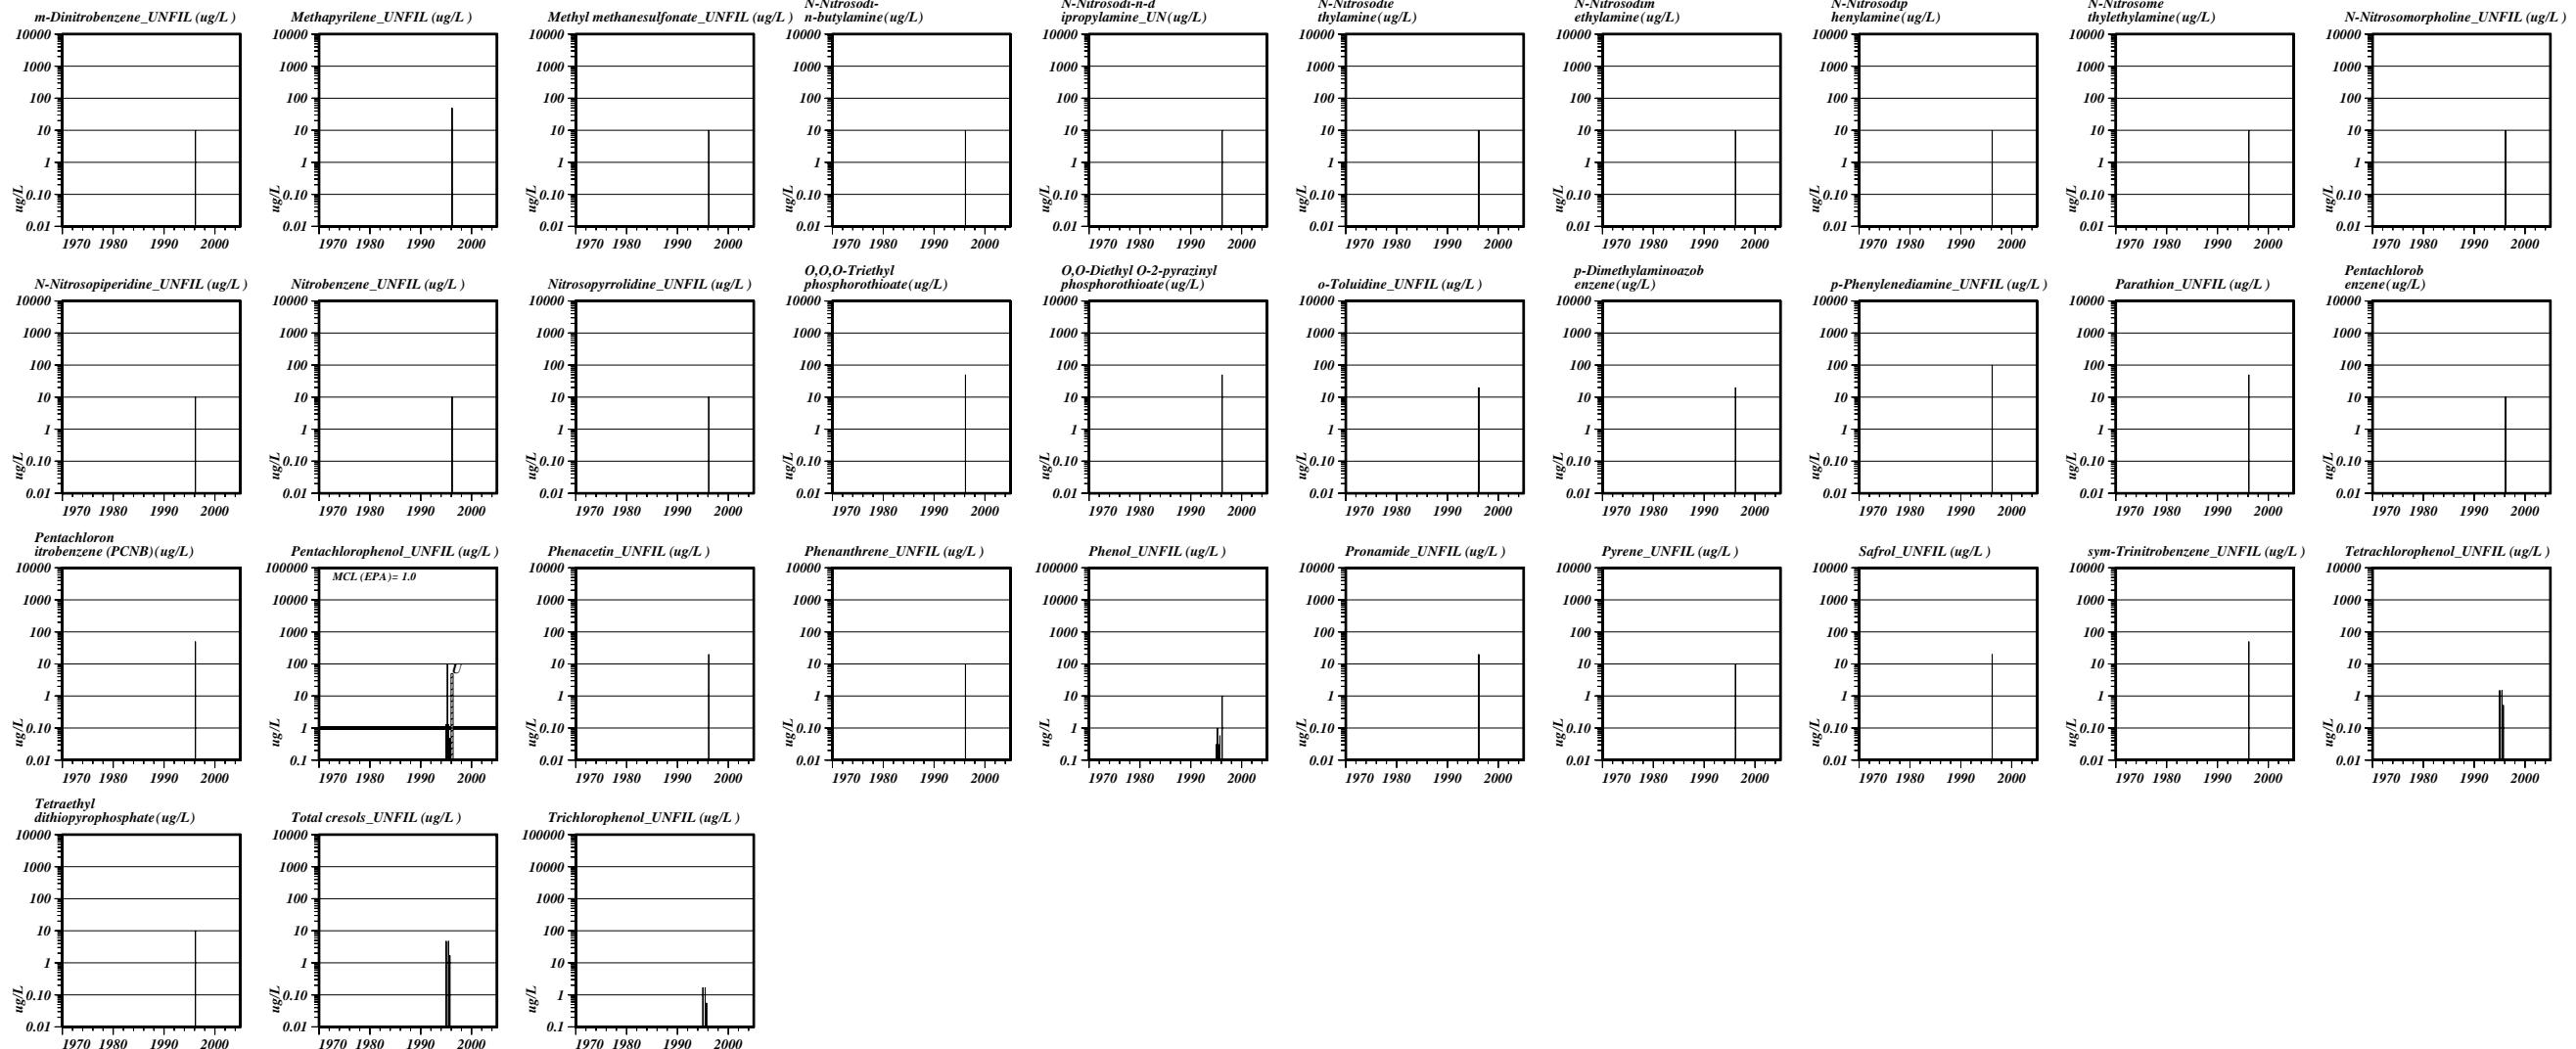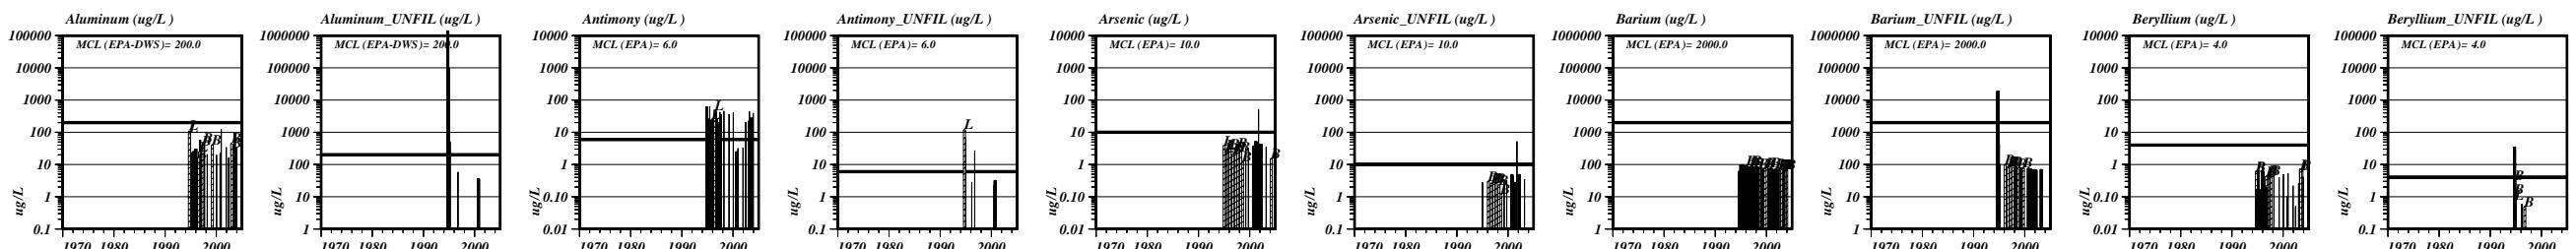**SEMI-VOLATILE ORGANIC COMPOUNDS****METALS & PHYSICAL PARAMETERS**


LABORATORY QUALIFIER FLAGS in HEIS are \*, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value:L=Value between IDL and CRQL (estimated):T=Tentatively identified compound:  
EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit:THIN BARS=Value Below Detection Limit:HATCHED BARS=Value With Data Qualifier Flag

# DOE HANFORD SITE - GROUNDWATER QUALITY DATA PLOTS

wellseries-600-699 WELL#=699-36-70A

## METALS & PHYSICAL PARAMETERS

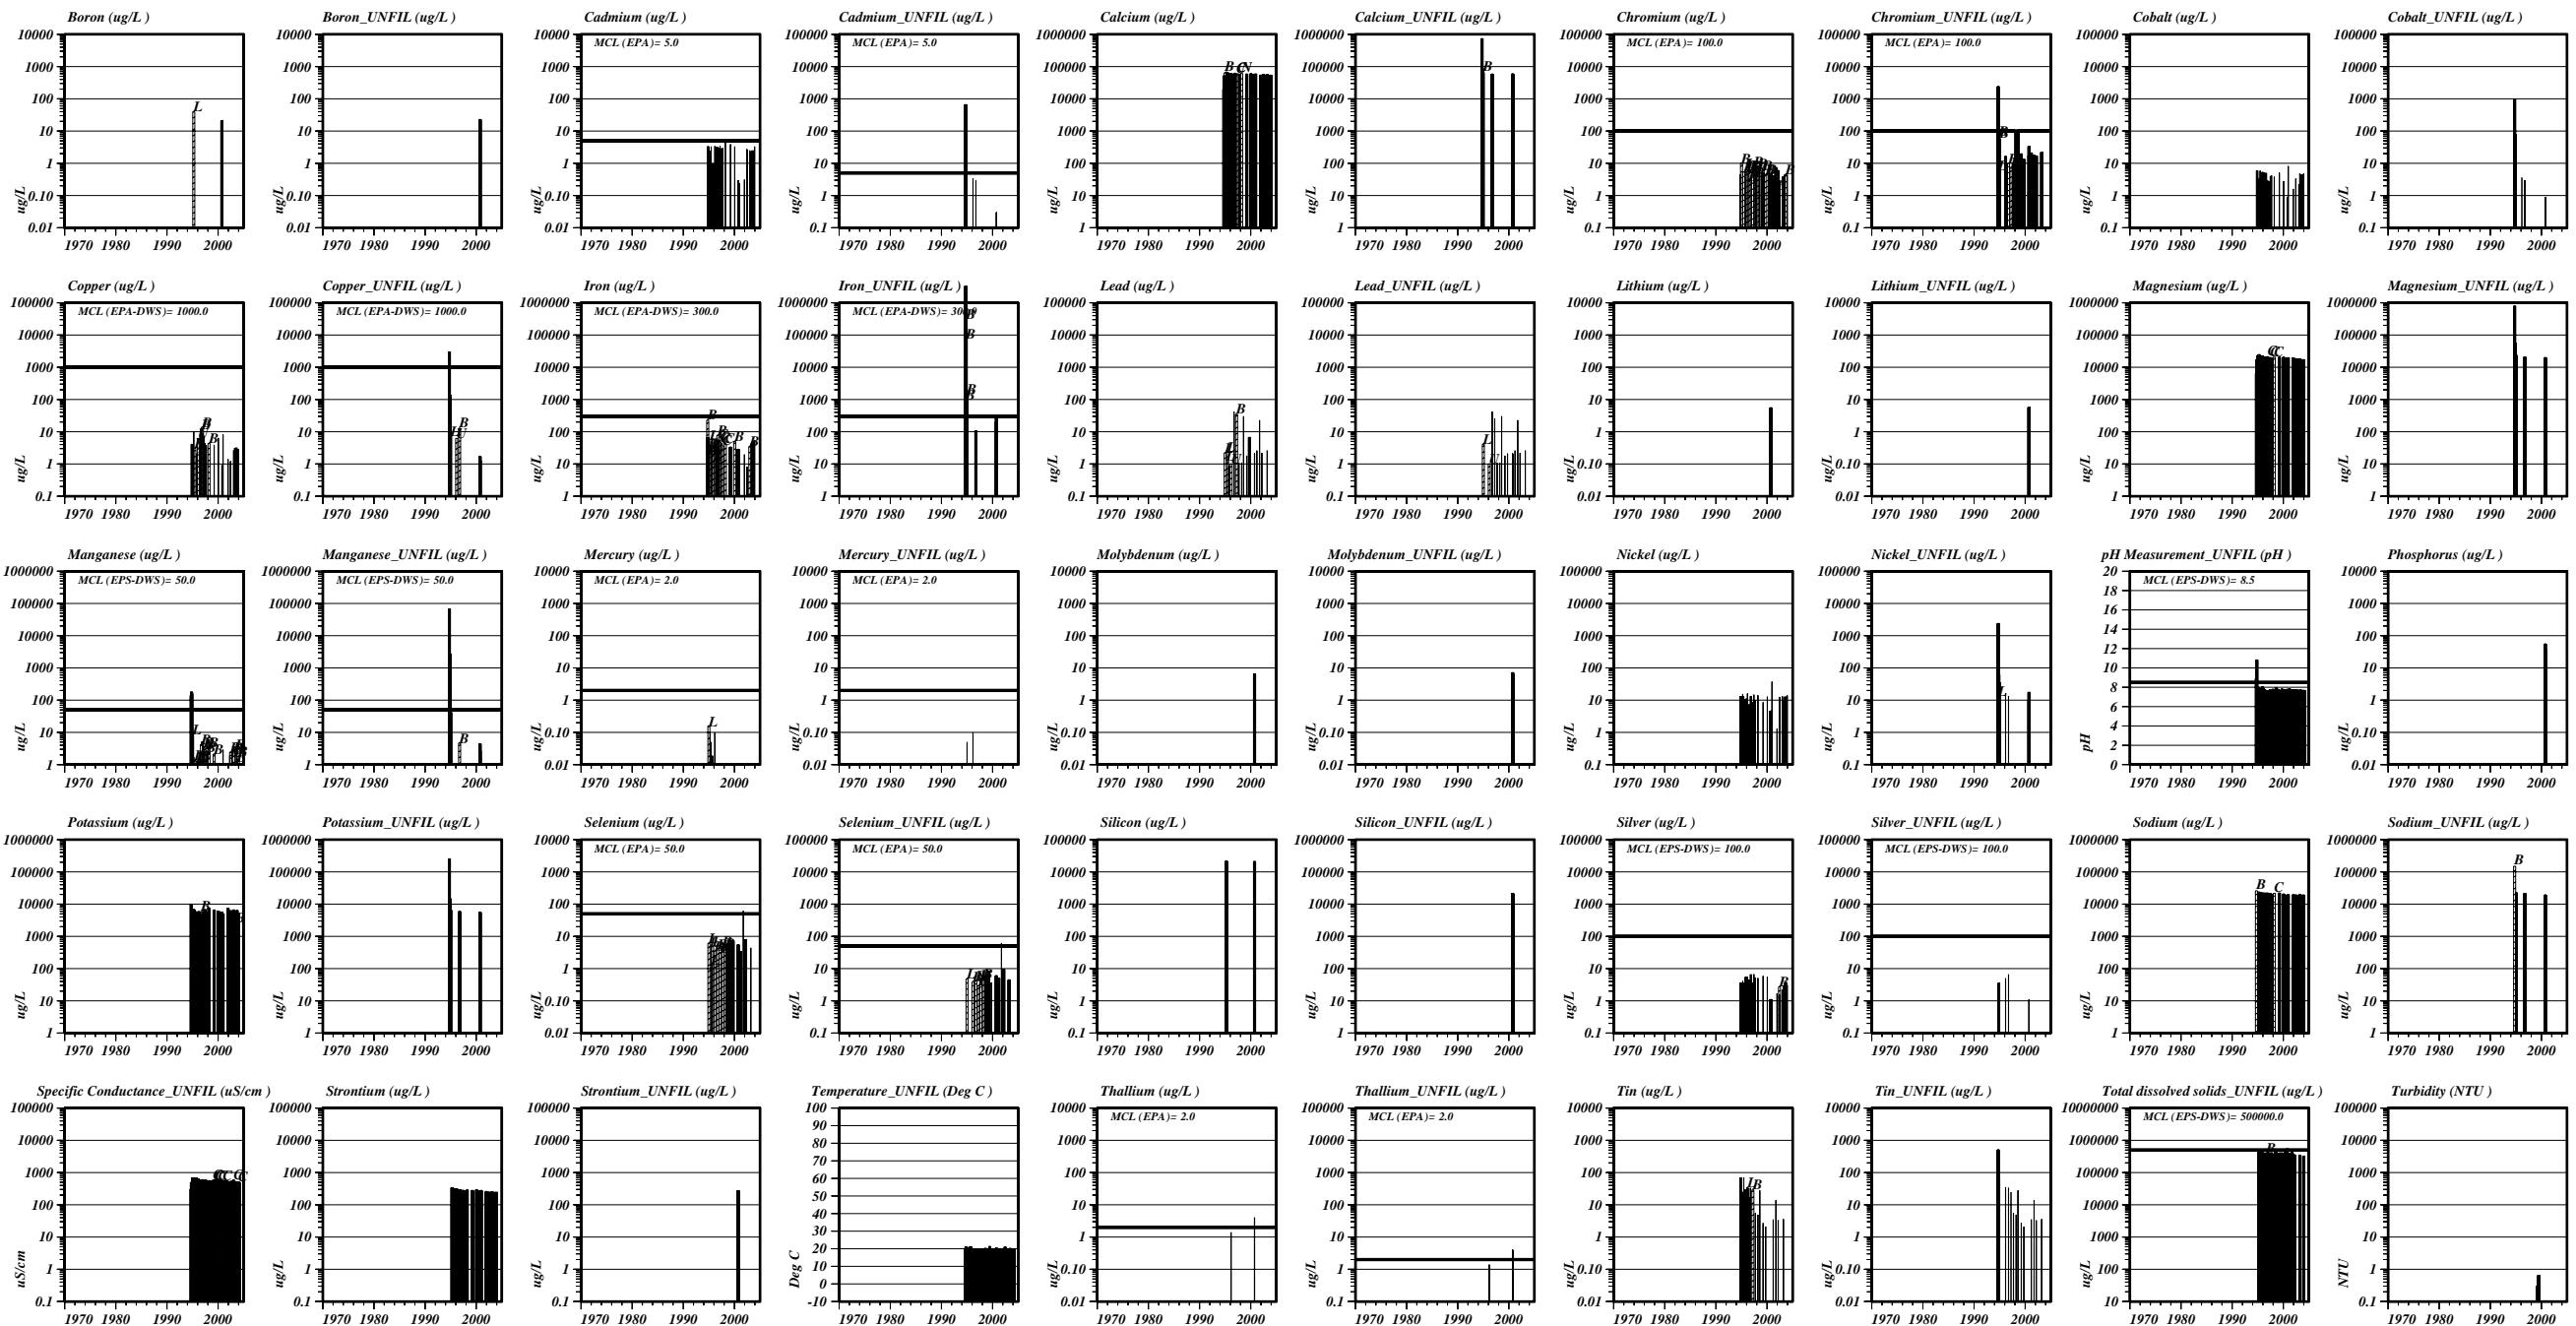














































LABORATORY QUALIFIER FLAGS in HEIS are \*, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value; L=Value between IDL and CRQL (estimated); T=Tentatively identified compound:  
EPA-IGR=EPA-Implementation Guidance for Radionuclides; WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit; THIN BARS=Value Below Detection Limit; HATCHED BARS=Value With Data Qualifier Flag

# DOE HANFORD SITE - GROUNDWATER QUALITY DATA PLOTS

wellseries-600-699 WELL#=699-36-70A


## METALS & PHYSICAL PARAMETERS

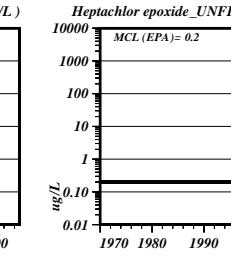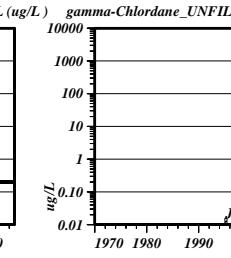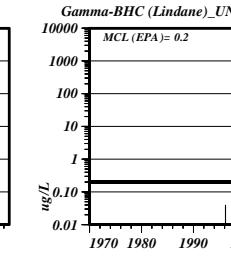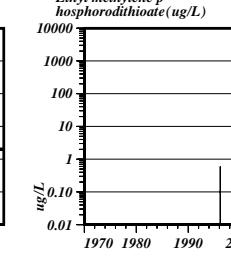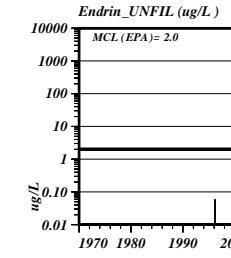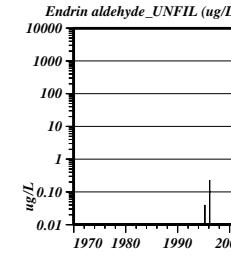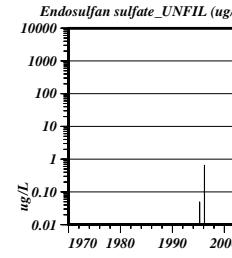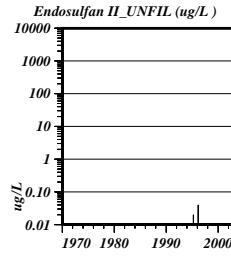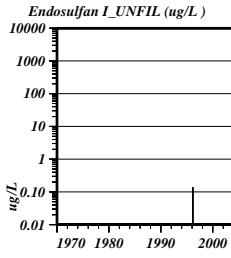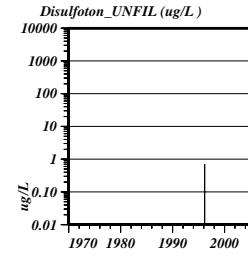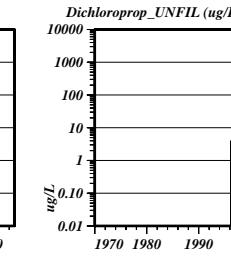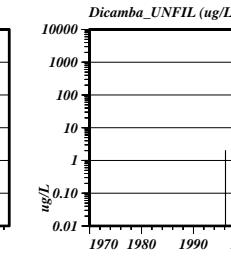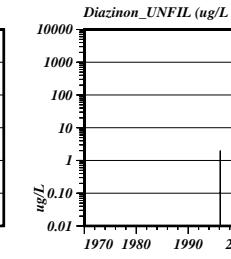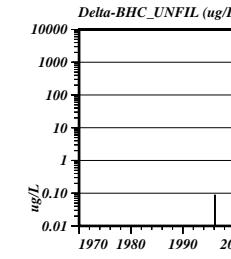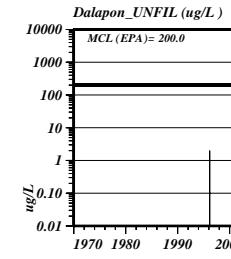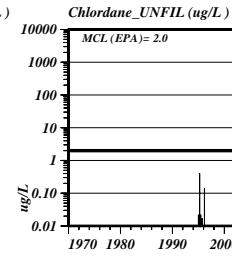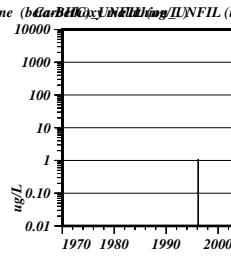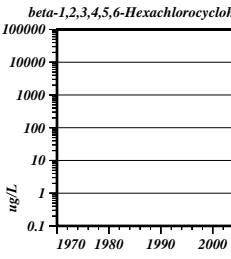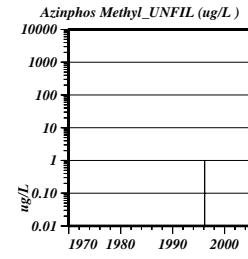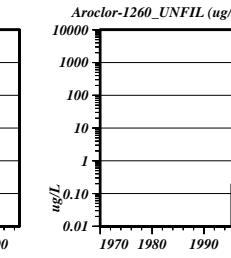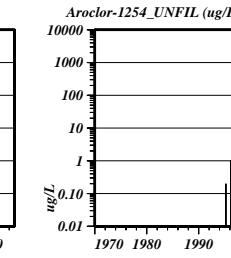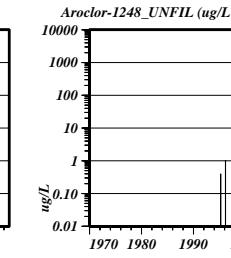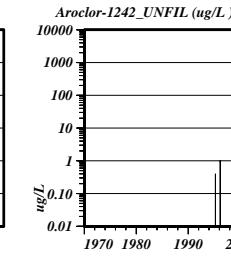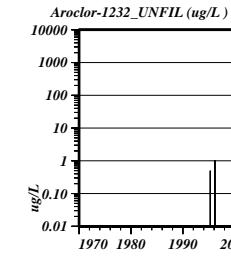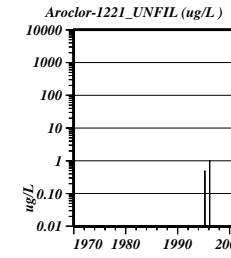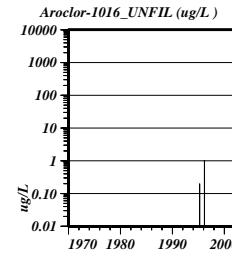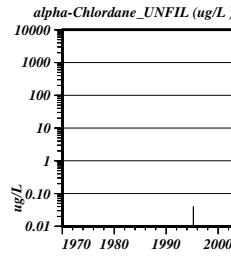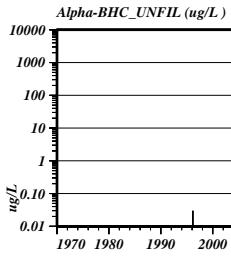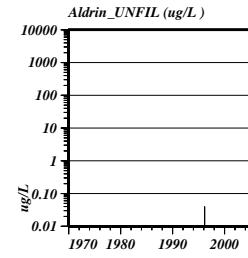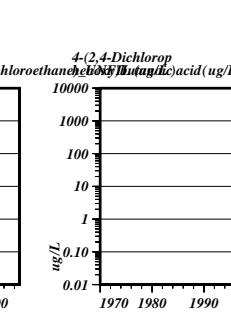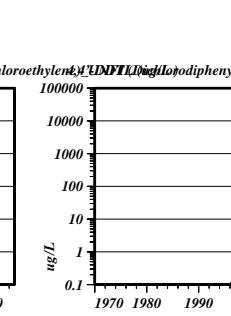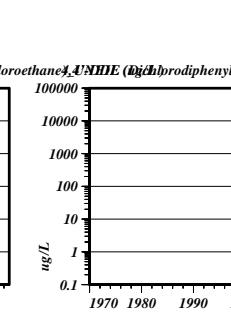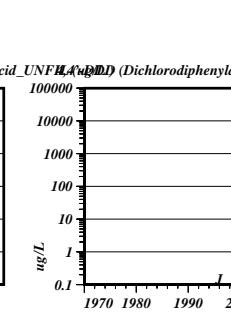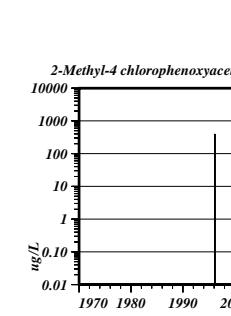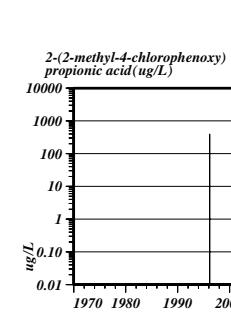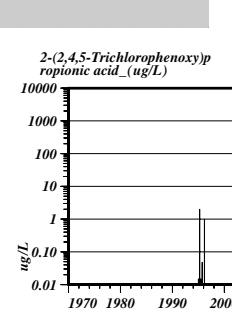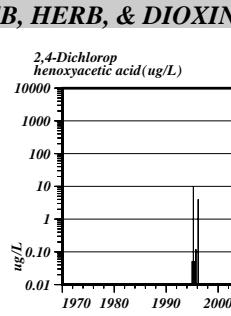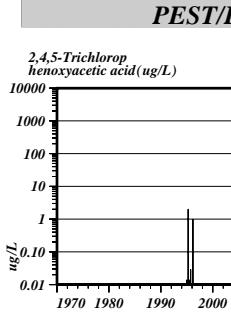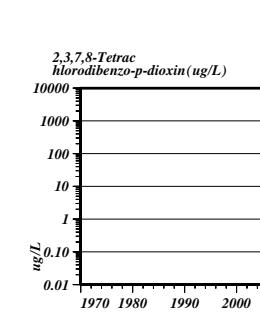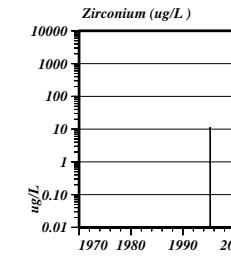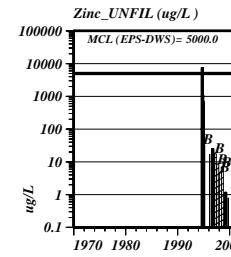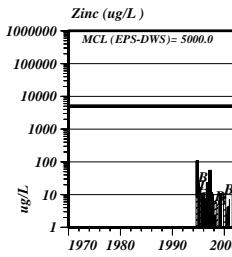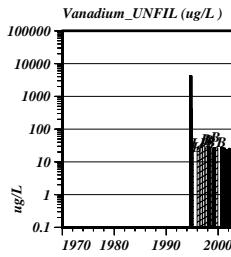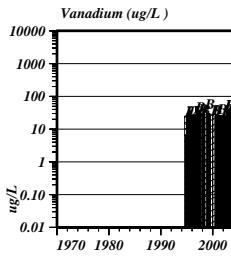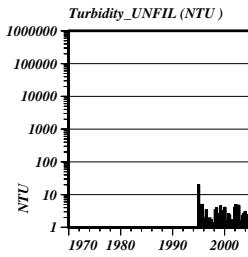


LABORATORY QUALIFIER FLAGS in HEIS are \*; >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value; L=Value between IDL and CRQL (estimated); T=Tentatively identified compound;  
EPA-IGR=EPA-Implementation Guidance for Radionuclides; WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit; THIN BARS=Value Below Detection Limit; HATCHED BARS=Value With Data Qualifier Flag

## PEST/PCB, HERB, &amp; DIOXINS

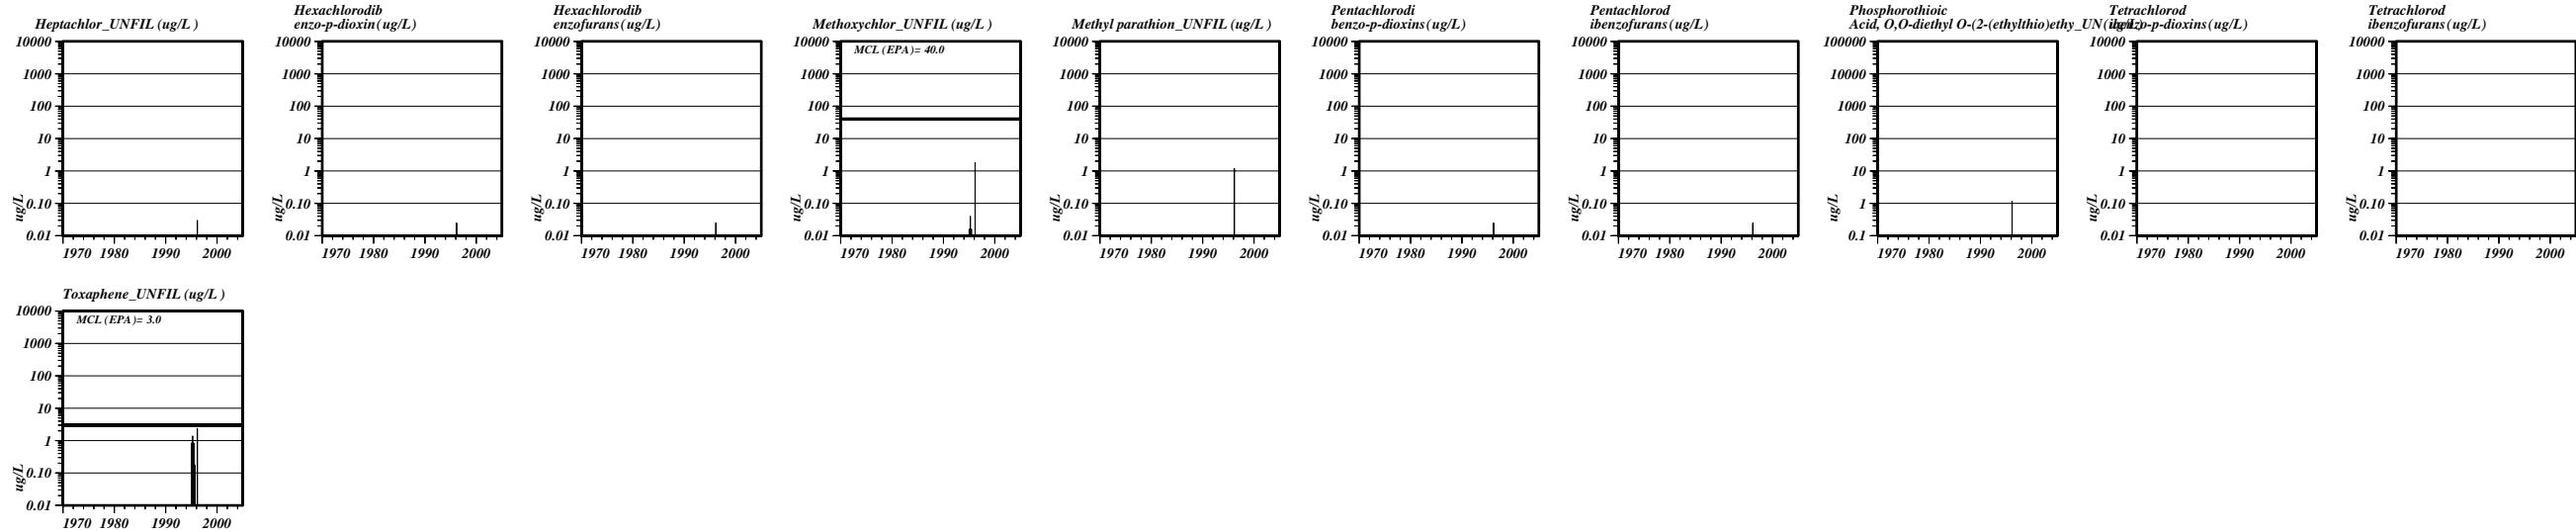

## GENCHEM &amp; ORGANICS &amp; GENORGANICS

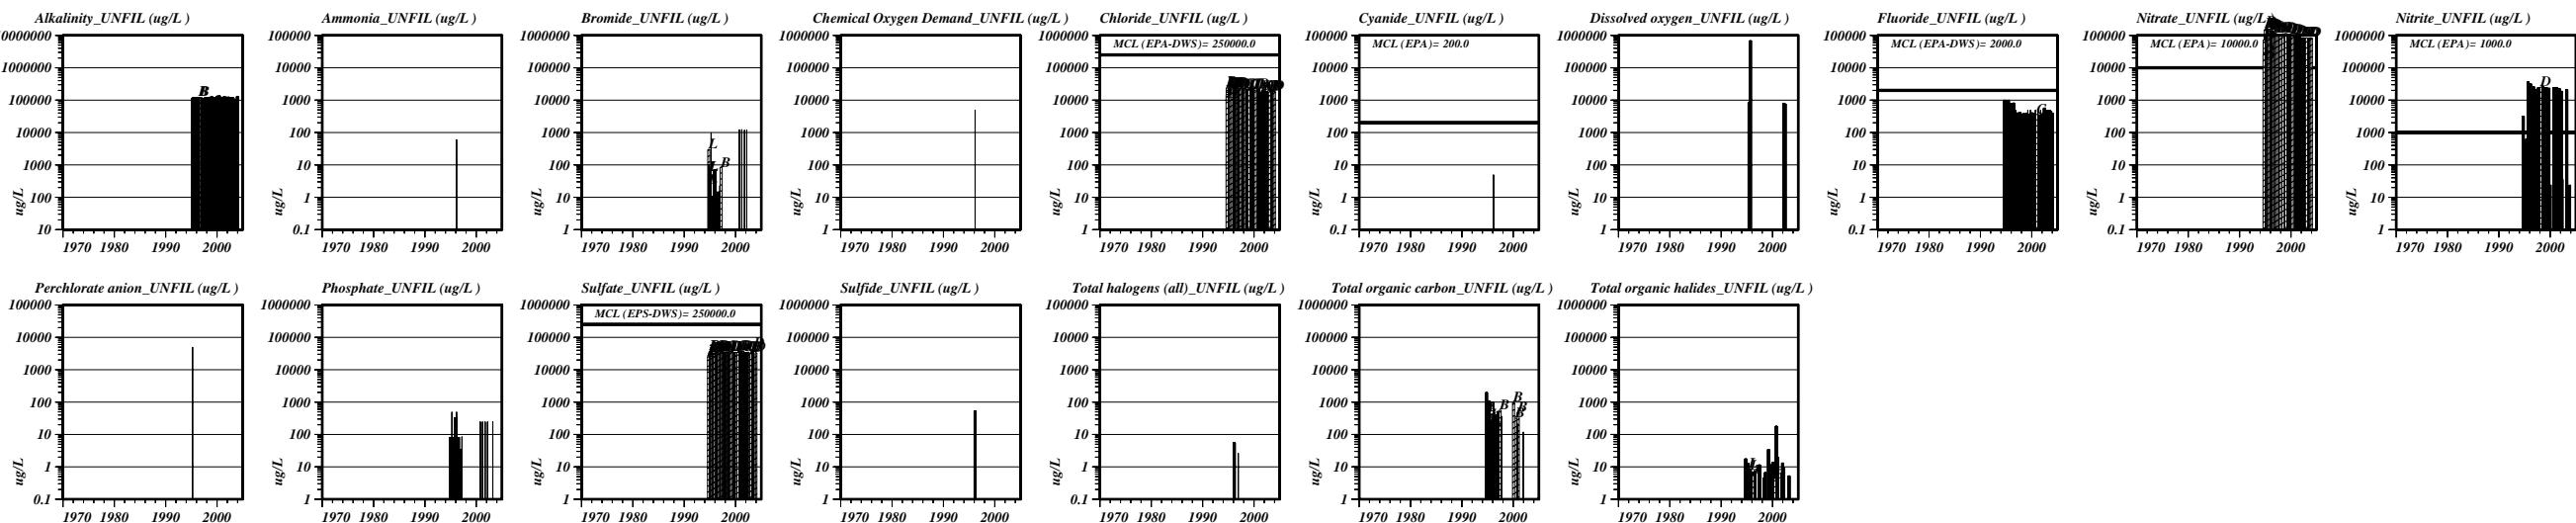

LABORATORY QUALIFIER FLAGS in HEIS are \*, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value; L=Value between IDL and CRQL (estimated); T=Tentatively identified compound:  
EPA-IGR=EPA-Implementation Guidance for Radionuclides; WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit; THIN BARS=Value Below Detection Limit; HATCHED BARS=Value With Data Qualifier Flag